

APPLICATION INSTRUCTIONS

SublimPlus

Stunning bright colors, very easy to use, and a great PU touch, it's definitely time to go Subim !

FEATURES:



**PU
water
based**



120 μ



**Cotton, polyester,
blended fabrics..**
Less suitable for nylon
and other coated textiles.



Sublimation

SUBLIMATION CONDITIONS:



190 °C



20 - 30 s



medium

Place sublimation paper, printed side up, on the press first and place SublimPlus, print side down, on top.

CUTTING CONDITIONS:



**Blade
30 - 45°**



**low/
medium**



30 - 40 cm/s

TRANSFER CONDITIONS:



150 °C



5 s + 10 s
without Tape



medium



warm peel



30 - 40 °C



1. Print mirrored on suitable sublimation paper (with registration marks)



2. Transfer the sublimation pigments



3. Cut contour




4. Weed design



5. Transfer, remove tape, done !

► PACKAGING

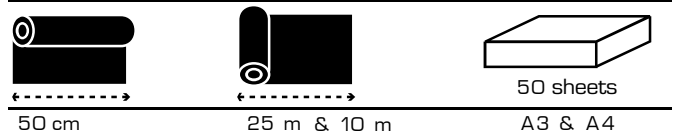

Store in a cool and dry place; protect against the influence of light when stored. We recommend not to exceed a storage period of 12 months. The technical specifications rest on extensive tests and technical research. Due to the variety of possible influences during refinement, and use, the specifications should be viewed as reference values. We recommend a suitability test on the original material. A legally binding warranty of specific characteristics cannot be derived from our specifications.